


QUICK TURN AROUND FOR T- PIPE USING BELZONA 7311 AT PETROCHEMICAL PLANT

ID: 10240

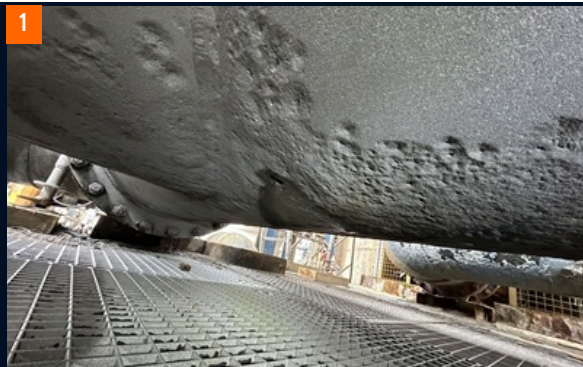

PROBLEM

Corrosion had caused perforation on a cooling water pipe in a petrochemical site that produces ammonium nitrate fertilizers had caused the pipe to leak severely. This pipe was operating in the nitric acid area and therefore the corrosion was very intense. The Client needed a quick and repair method that could be carried out within a very short shutdown period but also provided a long-term solution.

APPLICATION SITUATION

This petrochemical site which produces ammonium nitrate fertilizers required a quick solution for their pipe which was suffering from several leaks caused by corrosion. The work was required to be carried out quickly during their short production shutdown period. We had previously repaired an pipe elbow for this client by bonding a plate, the Client was very happy with this previous repair and enquired as to whether we could do something similar.

APPLICATION METHOD

The surface was prepared by using sandblasting and the perforation was sealed using Belzona 9611. The damaged areas next to the perforation were then repaired using Belzona 1212, then the curved plate was bonded using 24 unites of Belzona 7311 with straps for tightening. Finally, a layer of Belzona 5811 was applied to provide protection from future damage as the corrosion was very intense.

BELZONA FACTS

The Client was very happy with the final application as it required no hotwork and was able to be carried out within their very short shutdown period.

INDUSTRY

Chemical & Petrochemical

LOCATION

France

APPLICATION DATE

April 2026

PRODUCTS

Belzona 1212
Belzona 5811 (Immersion Grade)
Belzona 7311

SUBSTRATE

Stainless-steel

PHOTOS

1. Damage pipe
2. Belzona 1212 applied to seal a live leak and rebuild the pitted area
3. Curved plate bonded using Belzona 7311
4. Image of T- bend pipe

For more examples of Belzona Know-How in Action, please visit khia.belzona.com

Belzona products are manufactured
under an ISO 9001 Registered
Quality Management System.

www.belzona.com

