


BELZONA EMERGENCY PIPE REPAIR AT SCHOOL

ID: 2927

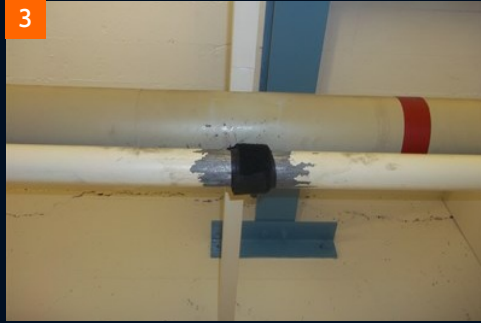

PROBLEM

Two small pin holes had appeared under the paint in the main water pipe. Water was now leaking onto the floor creating a slip hazard over a large area.

APPLICATION SITUATION

Water pipe in a school boiler room

APPLICATION METHOD

Application was carried out in accordance with Belzona Know-How System Leaflet VPF-11

BELZONA FACTS

The mains water pipe could only shut down for a short period of time as it supplied the kitchens and the toilet block, a very fast repair was required. The repair was carried out within an hour with no disruption to the school or pupils.

INDUSTRY

Buildings & Structures

LOCATION

Worcester, UK

APPLICATION DATE

November 2011

PRODUCTS

Belzona 1291 (ES Metal)

Belzona 1221 (Super E Metal)

SUBSTRATE

Steel Pipe

PHOTOS

1. Surface preparation
2. Application of Belzona 1291 to stem the leak
3. Belzona 1291 being held in place with tourniquet during cure
4. Belzona 1221 applied with Belzona 9341 (Reinforcement tape) over the Belzona 1291 to complete the repair

For more examples of Belzona Know-How in Action, please visit khia.belzona.com

Belzona products are manufactured under an ISO 9001 Registered Quality Management System.

www.belzona.com

