
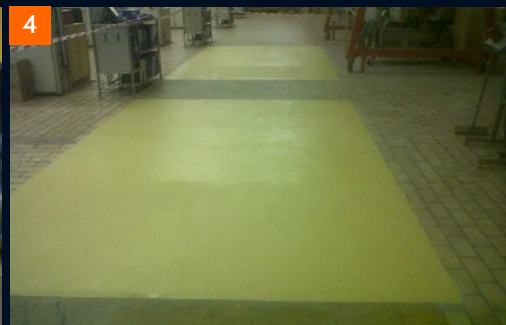


MAJOR BELZONA SAFETY REPAIRS IN BOTTLING HALL

ID: 3010

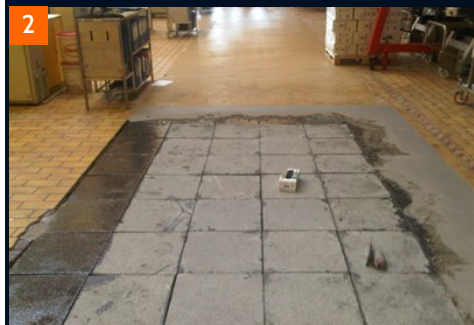

PROBLEM

The areas were approximately 80mm deep and required filling and levelling. The three areas were a severe safety risk to the trucks operating in the plant leading to imbalance and disruption to production. The repairs had to be completed over a weekend shut-down.

APPLICATION SITUATION

Three areas of extremely uneven flooring in the bottling hall. Areas included failing quarry tiles, epoxy screed and concrete.

APPLICATION METHOD

Application was carried out in accordance with Belzona Know-How System leaflet FPA-1. After breaking out the failed epoxy flooring, quarry tiles and deteriorated concrete the levels were made up by bonding pre-cast concrete slabs into place before applying a 6mm screed of Belzona® 4131. Finally 2 coats of Belzona 5231, incorporating additional aggregate, were applied to create non-slip surface.

BELZONA FACTS

The repairs were completed over a weekend and the speed of application and cure ensured the plant was operating normally when opened on Monday. The system offers a level, safe, hard wearing surface ensuring this busy bottling plant operated at maximum efficiency without any loss of production.

INDUSTRY

General Industry

LOCATION

Distillery, Glasgow, UK

APPLICATION DATE

November 2011

PRODUCTS

Belzona 4131 (Magma Screed)
Belzona 5231 (SG Laminate)

SUBSTRATE

Concrete, Quarry tiles and epoxy coating

PHOTOS

1. Depth and problem of repairs required
2. Concrete slabs being bedded in prior to final Belzona 4131 screed
3. Finished screed application
4. 2 coats of Belzona 5231 with encapsulated aggregate applied for safety and grip

For more examples of Belzona Know-How in Action, please visit khia.belzona.com

Belzona products are manufactured
under an ISO 9001 Registered
Quality Management System.

www.belzona.com

