


BELZONA PROTECTS OPEN DRAINS TANK

ID: 385

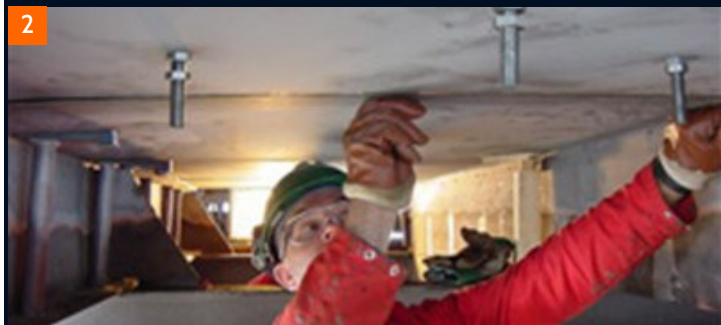

PROBLEM

Due to the location of the tank it is subjected to a salt environment which accelerates corrosion externally as well as internal corrosion from the process chemicals.

APPLICATION SITUATION

The open drains tank located below the platform handles the waste chemicals used in the platforms processes. Due to the location it would require extensive lifting facilities and mechanical work to replace.

APPLICATION METHOD

The tank base was grit blasted and plates were secured in position using Belzona® 1111 and held in place using chocks. Once the Belzona® 1111 had been allowed to cure, Belzona® 5811 was injected into the gap between the plate and the tank base. In addition all of the tank nozzles were wrapped using Belzona® 1111 / 9341 along with all of the tank base weld seams from the tank side/base joint. Following this the new tank base and sides were coated with Belzona® 6111 / 5111 for future corrosion protection.

BELZONA FACTS

The Belzona solution offered the customer a rapid turnaround as well as a cost saving in excess of \$200,000.

INDUSTRY

Oil & Gas

LOCATION

North Sea gas producer

APPLICATION DATE

2003

PRODUCTS

Belzona 1521
Belzona 1111
Belzona 9341
Belzona 5811
Belzona 6111
Belzona 5111

SUBSTRATE

Mild Steel

PHOTOS

1. Front view showing Belzona product
2. Side view
3. Sealing of tank base seams using Belzona 1111

For more examples of Belzona Know-How in Action, please visit khia.belzona.com

Belzona products are manufactured under an ISO 9001 Registered Quality Management System.

www.belzona.com

