


# BELZONA SEALS LEAKING BALCONY ROOF AT WORLD FAMOUS COLLEGE

ID: 4689

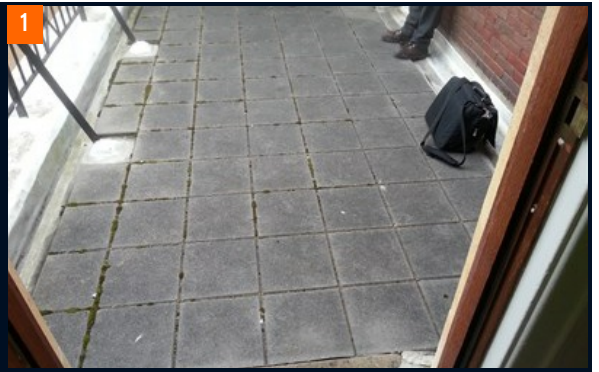

## PROBLEM

The asphalt roof was leaking underneath the concrete slabs, causing water damage to the rooms below. To repair the roof the College was planning to remove the concrete slabs, replace the asphalt roof and then reinstall the concrete slabs.

## APPLICATION SITUATION

An asphalt balcony, used as a walkway, covered with concrete slabs.

## APPLICATION METHOD

Application was carried out in accordance with Belzona Know-How System Leaflet RPA-6. The gaps between all paving slabs were cleaned and filled with Belzona 4131. A fully reinforced Belzona® 3131 system was then applied to weatherproof the area. This was followed by a further coat of Belzona® 3131 blinded with Belzona 9231 aggregate to create a non-slip walkway.

## BELZONA FACTS

To replace the leaking asphalt roof with new asphalt was expensive, would expose the building to the weather and would take over one week. The Belzona system meant the existing roof substrate stayed intact, the roof coating was completed in 3 days and new Belzona non-slip surface provided additional safety.

## INDUSTRY

Buildings & Structures

## LOCATION

College, Cambridge, UK

## APPLICATION DATE

August 2013

## PRODUCTS

Belzona 4131 (Magma Screed)  
Belzona 3131 WG Membrane  
Belzona 9231 (Surefoot Aggregate)

## SUBSTRATE

Asphalt and concrete

## PHOTOS

1. Leaking balcony roof with paving slabs
2. Close up of paving slab edge
3. Gaps between slabs filled with Belzona 4131
4. Balcony roof coated with Belzona 3131 system with 3rd coat incorporating Belzona 9231 aggregate anti-slip system

For more examples of Belzona Know-How in Action, please visit [khia.belzona.com](http://khia.belzona.com)

Belzona products are manufactured under an ISO 9001 Registered Quality Management System.

[www.belzona.com](http://www.belzona.com)

