


BELZONA PROTECTS CHILLER TUBE SHEET

ID: 5213

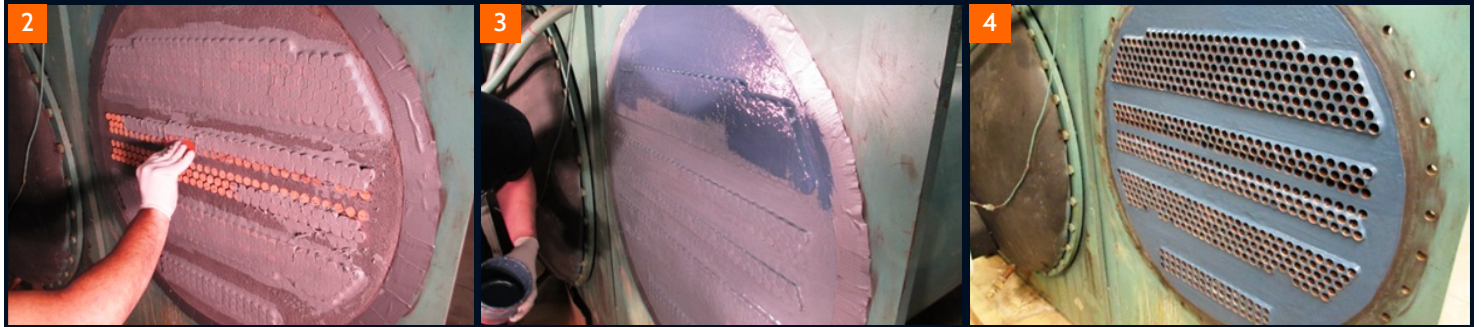

PROBLEM

The chiller tube sheet was suffering from corrosion due to bi-metallic corrosion.

APPLICATION SITUATION

Chiller tube sheet.

APPLICATION METHOD

The application was carried out in accordance with Belzona Know-How System Leaflet HEX-1 for repairing eroded-corroded tube sheets. The surface was prepared by grit blasting and the surface was washed with Belzona 9111 to remove all residual blasting debris. The tubes were plugged with corks and Belzona 1111 was applied to the area using an applicator. The second coat of Belzona 1321 was applied with an applicator in accordance with the Belzona Instructions For Use.

BELZONA FACTS

Belzona 1321 offers protection against the effects of erosion-corrosion and has outstanding resistance to chemicals.

INDUSTRY

Heating, Ventilation & Air Conditioning

LOCATION

ON, Canada

APPLICATION DATE

September 2013

PRODUCTS

Belzona 1111 (Super Metal)
Belzona 1321 (Ceramic S-Metal)
Belzona 9111 (Cleaner/Degreaser)

SUBSTRATE

Steel

PHOTOS

1. Prior to application
2. Application in process
3. Application in process
4. Completed application

For more examples of Belzona Know-How in Action, please visit khia.belzona.com

Belzona products are manufactured
under an ISO 9001 Registered
Quality Management System.

www.belzona.com

Copyright © 1952-2026 Belzona International Limited.


BELZONA