


BELZONA SEALS SKYLIGHT TO PREVENT WATER PENETRATION

ID: 5302

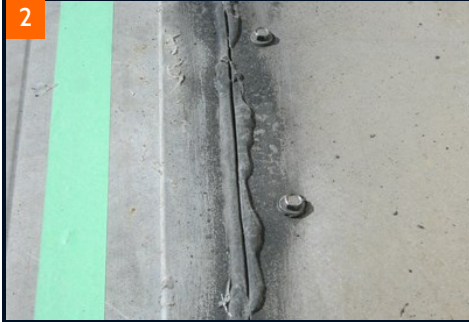

PROBLEM

Water penetration between roofing sheets and around the skylight.

APPLICATION SITUATION

A skylight on the roof of a building.

APPLICATION METHOD

The application was carried out in accordance with Belzona Know-How System Leaflet RPA-01 for repairing and sealing joints and seams. A wire brush was used to remove any loose adherent and flaking rust and Belzona 3921 was applied to the prepared surface. Belzona 9311 was layed over the conditioned area and Belzona 3111 was applied with a soft bristle brush as a two coat system in accordance with Belzona Instructions For Use.

BELZONA FACTS

Revisited in June 2014 with no leaks to date. Belzona 3111 is a single component, solvent free, microporous coating for the long-term repair and protection of all types of roofs. This versatile liquid applied material provides outstanding weatherproofing and waterproofing properties with excellent protection against infrared and ultra violet radiation.

INDUSTRY

Buildings & Structures

LOCATION

Cambridge, ON, Canada

APPLICATION DATE

August 2010

PRODUCTS

Belzona 3111 (Flexible Membrane)
Belzona 3921 (GSC Surface Conditioner)
Belzona 9311 (Reinforcing Sheet)

SUBSTRATE

Corrugated steel

PHOTOS

1. Prior to application
2. Preparation in progress
3. Application in progress
4. Completed application

For more examples of Belzona Know-How in Action, please visit khia.belzona.com

Belzona products are manufactured
under an ISO 9001 Registered
Quality Management System.

www.belzona.com

