
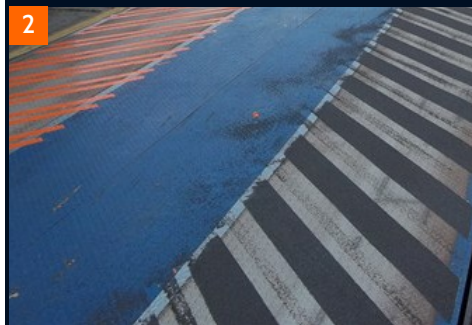


# BELZONA GRIP SYSTEM KEEPS LORRIES MOVING

ID: 6107

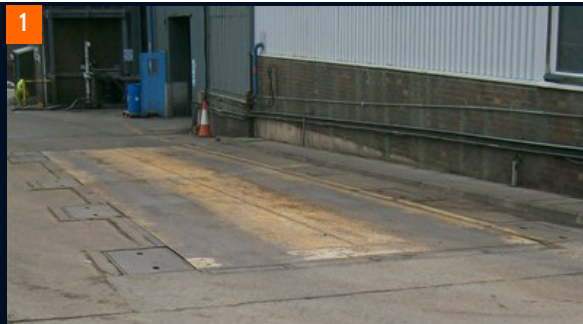

## PROBLEM

The client had an old weighbridge that had been constructed on a slope. Lorries were struggling to move off this as their tyres would just spin on the polished metal. They then had a new deck fabricated, but it was found that the problem persisted. Vehicles would have to reverse back towards the production area in order to gain enough momentum to get over the bridge. After a couple of “near misses”, a solution was urgently needed.

## APPLICATION SITUATION

Checker Plate Weighbridge.

## APPLICATION METHOD

Application was carried out in accordance with Belzona Know-How System Leaflet FPA-8. Belzona 1321 blinded with Belzona 9211 was applied in a chevron pattern with Belzona 5811 applied between to provide corrosion protection.

## BELZONA FACTS

Due to the constant heavy traffic, Belzona 1321 was chosen to hold the aggregate due to the materials’ very high compressive strength. As the materials were also self-priming, all of the work could be completed within a weekend, allowing the weighbridge to return to service quickly. In addition, the Belzona materials provided outstanding grip together with abrasion and corrosion protection.

## INDUSTRY

Chemical & Petrochemical

## LOCATION

Chemical Plant, Cleveland, UK

## APPLICATION DATE

2011

## PRODUCTS

Belzona 5811 (Immersion Grade)

Belzona 1321 (Ceramic S-Metal)

Belzona 9211 (Supergrip Aggregate)

## SUBSTRATE

Checker plate steel

## PHOTOS

1. Original weighbridge in 2010
2. New weighbridge with application underway
3. Belzona 5811 being applied between grip areas
4. Completed application in 2011

For more examples of Belzona Know-How in Action, please visit [khia.belzona.com](http://khia.belzona.com)

Belzona products are manufactured  
under an ISO 9001 Registered  
Quality Management System.

[www.belzona.com](http://www.belzona.com)

