


BELZONA 5892 REPAIRS A TANK IN BREWERY

ID: 8197

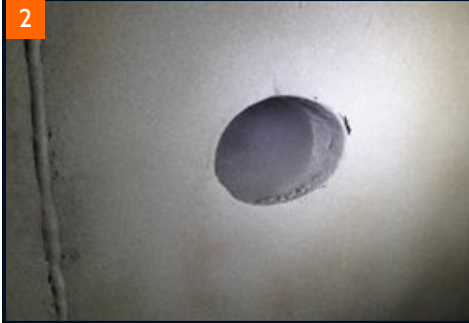

PROBLEM

The tank in the brewery was suffering from pitting corrosion of the welds, stub pipes and general corrosion of the internal metal sheets.

APPLICATION SITUATION

A brewery tank containing a beer solution required an product to repair pitting and an internal lining to prevent further corrosion & maintain hygienic conditions within the tank.

APPLICATION METHOD

Started out with grit blasting to prepare the surface. This was then followed by repairing the welds with Belzona 1111. The repairs of the connectors with Belzona 9341 used in conjunction with Belzona 1111. The 1st layer of Belzona 5892 at an average thickness about 250 µm. Application of the 2nd layer Belzona 5892 average thickness about 250 µm. Finally a thickness test was carried in line with the Belzona 5892 IFU. The application was carried out in accordance with Belzona System Leaflet TCC-03.

BELZONA FACTS

The client chose Belzona due to it's product quality and little down time. The Belzona 5892 was a great choice due to it's ability work under immersed conditions at a competitive cost.

INDUSTRY

Food & Drink

LOCATION

Poland

APPLICATION DATE

2019

PRODUCTS

Belzona 1111 (Super-Metal)

Belzona 5892

Belzona 9341 (Reinforcement Sheet)

SUBSTRATE

Steel

PHOTOS

1. Brewery Tank
2. Pitting Corrosion on the joints inside the tank.
3. Re profiling joints with Belzona 1111
4. Application of the Belzona 5892

For more examples of Belzona Know-How in Action, please visit khia.belzona.com

Belzona products are manufactured under an ISO 9001 Registered Quality Management System.

www.belzona.com

