


TURBO SEPARATOR REPAIR WITH BELZONA 1818

ID: 8480

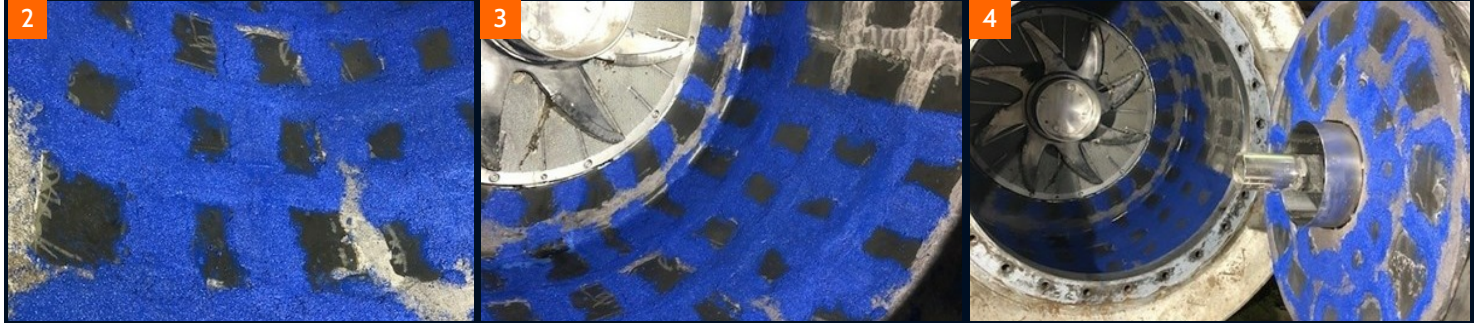

PROBLEM

The Turbo Separator is a disc screen specially designed for course screening, primarily removing light and heavy impurities from wastepaper. The unit is lined with thick Basalt tiles and has a hard-wearing grouting compound applied over the joints between the tiles. Over the years, this grouting compound would wear away leaving the joints unprotected. This is a very abrasive environment.

APPLICATION SITUATION

Turbo separator in Paper recycling plant

APPLICATION METHOD

After cleaning out the pulp, the Turbo separator was dried out using rags. Surface preparation was achieved using a diamond blade on an angle grinder to create a "key" for Belzona 1818.

Belzona 1818 was mixed and applied with ease, including overhead areas.

BELZONA FACTS

Previously, Belzona 1812 was used to repair this turbo separator. Belzona 1818 provided: - Easier vertical and overhead application - Lower surface preparation needs - Quicker back to service - Time and cost savings.

INDUSTRY

Pulp & Paper

LOCATION

Brisbane, Australia

APPLICATION DATE

March 2021

PRODUCTS

Belzona 1818

SUBSTRATE

Carbon steel

PHOTOS

1. Worn grouting system
2. Application in progress
3. Application in progress
4. Application complete

For more examples of Belzona Know-How in Action, please visit khia.belzona.com

Belzona products are manufactured under an ISO 9001 Registered Quality Management System.

www.belzona.com


BELZONA

Copyright © 1952-2026 Belzona International Limited.