


BELZONA REPAIRS TO A SEVERELY ERODED COPPER CASTING PUMP

ID: 9953

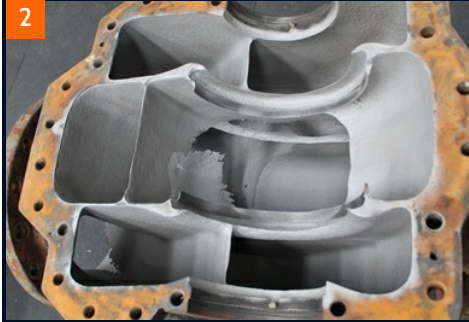

PROBLEM

This pump had severe erosion damage with multiple through-wall defects. Their new pump wasn't due to arrive for six months, and the pump needed to remain operational until that date

APPLICATION SITUATION

The pump was in such a state of disrepair, that replacing the asset seemed to be the most logical. However due to tight time constraints, the pump needed a repair that would ensure a quick return to service to reduce severe losses on downtime.

APPLICATION METHOD

The pump was grit-blasted, back to minimum surface profile. The through wall defects and eroded edges of the pump were rebuilt using Belzona 9371. Then a two-coat system of Belzona 1391T was applied to protect against erosion/corrosion until new pump could be installed.

BELZONA FACTS

Without Belzona repair, the client would have faced significant losses trying to find an alternative solution. Belzona UK repaired and shipped the vital asset within a number of days to be

INDUSTRY

Food & Drink

LOCATION

Newport

APPLICATION DATE

August 2025

PRODUCTS

Belzona 1391T

SUBSTRATE

Cast Iron

PHOTOS

1. Severely eroded pumps with multiple through wall defects
2. Pump is grit blasted to minimum surface profile
3. Through wall defects and missing metal is rebuilt
4. Two coats on Belzona 1391T are applied to protect against erosion/corrosion at high temperatures under immersion

For more examples of Belzona Know-How in Action, please visit khia.belzona.com

Belzona products are manufactured under an ISO 9001 Registered Quality Management System.

www.belzona.com

